

## IsoCube Test 2: CBCT Report


### OVERALL RESULTS

 <p><b>PASS</b></p> <p>ALL TOLERANCES PASSING</p>	 <p>ANALYSIS COMPLETE</p>
--	--

### Image Information


Filename	C:\RIT\RIT113V4\Demo Images\Radia Demo Images\IsoCube\Test2_CBCT\12072197561
Institution	
Station	OBIWS
kVp	
mA	10
Protocol	
Filter	
Convolution Kernel	Ram-Lak
DICOM Slice Thickness(mm)	1
SOP Instance UID	1.2.246.352.63.1.5496289583395052717.8573631630682549138
Slice Location	
Distance Source to Detector	1500
Distance Source to Patient	0
Table Top Longitudinal Position	1403
Table Top Lateral Position	-18
SRS/SBRT Test	Tolerance: 1 mm

### Composite Sagittal View

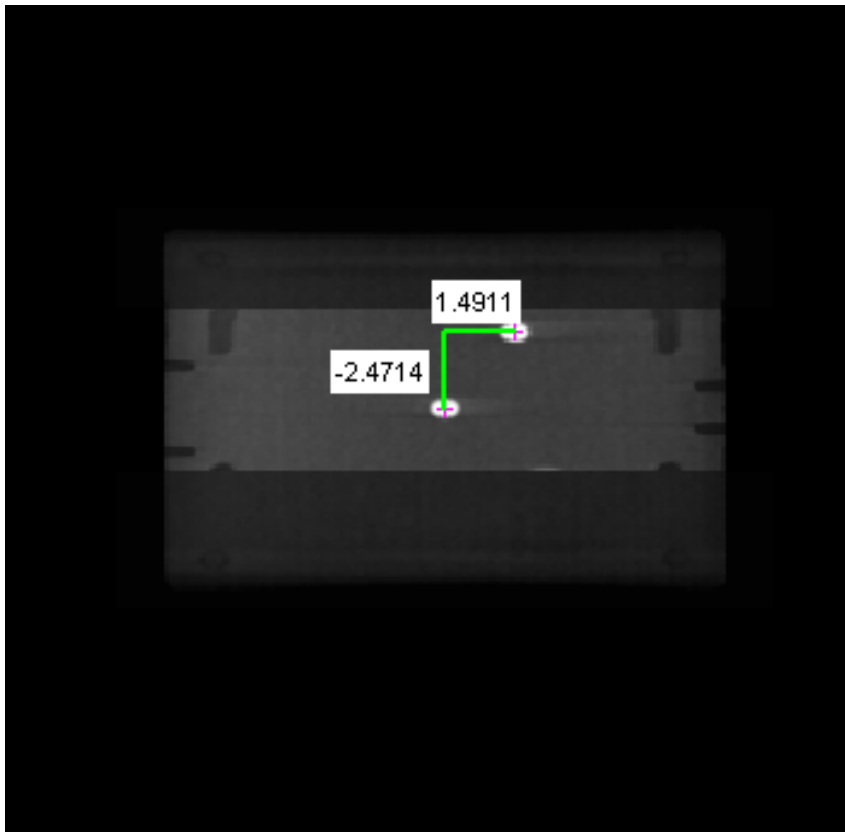

## Composite Axial View

3V4\Demo Images\Radia Demo Images\IsoCube\Test2\_CBCT

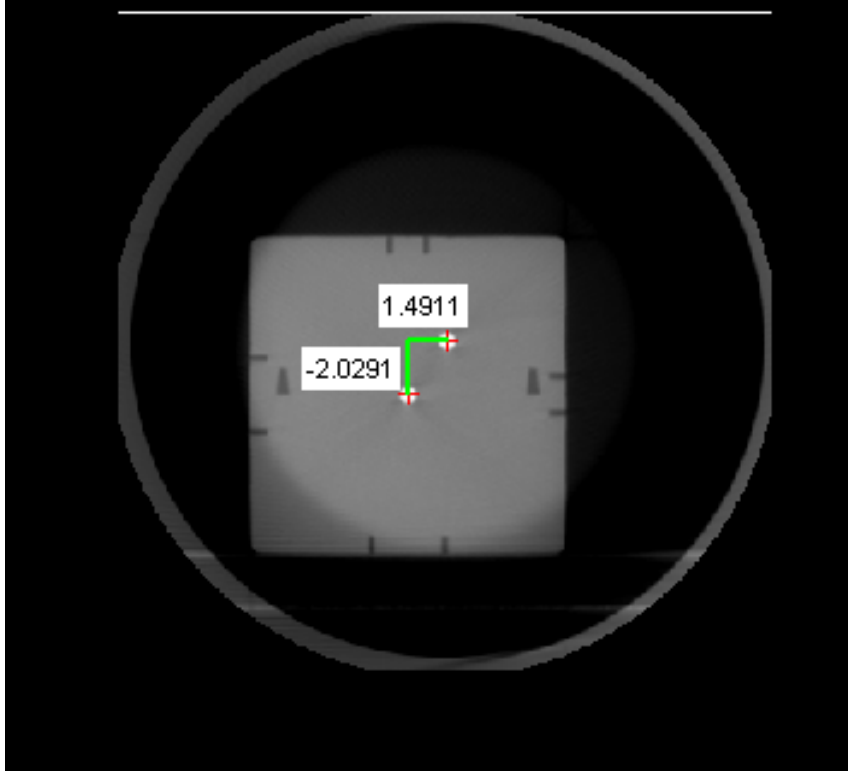

## Distance Table

	Measured (cm)	Expected (cm)	Difference (mm)	Max. Difference Tolerance (mm)	Pass-Fail Status
Longitude	-2.47	-2.50	0.29	1.00	Pass
Vertical	-2.03	-2.00	-0.29	1.00	Pass
Lateral	1.49	1.50	-0.09	1.00	Pass

## Isocenter Offset (IEC Coordinates 601)

Coordinate	Measurement
X	-139.00
Y	-105.14
Z	-0.50

## Analysis Settings

Axial Offset	0
Sagittal Offset	0
(0=center, 1=offset)	0